
## MODEL 211.004 /006 /016 /023 /026 /028 /042 /043 /056 /061 /065 /070 1# with CODE (596) Heat-insulating gl ass, vehicles up to model year 2003 with Audio 20 CC radio

A2/49 A2/56 Telephone and GPS roof antenna Radio control panel and navigation unit

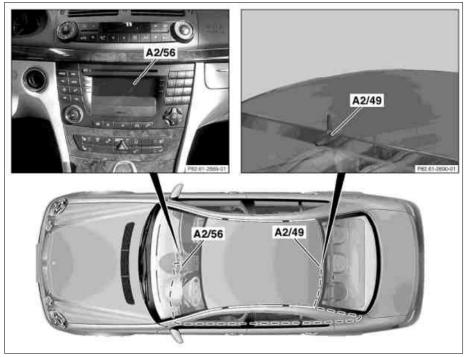

P82.61-2691-06

X	Remove		
⚠ Danger!	Risk of explosion caused by oxyhydrogen gas. Risk of poisoning and caustic burns caused by swallowing battery acid. Risk of injury caused by burns to skin and eyes from battery acid or when handling damaged leadacid batteries	No fire, sparks, open flames or smoking. Wear acid-resistant gloves, clothing and glasses. Pour battery acid only into suitable and appropriately marked containers.	AS54.10-Z-0001-01A
1	Disconnect ground cable of battery		
<b>₽</b> AR			AR54.10-P-0003T
(1)	Notes on battery	All models	AH54.10-P-0001-01A
i	Notes on AGM battery		AH54.10-P-0002-01A
2	Remove side paneling in trunk	i Right paneling.	
<b>₽</b> AR		With code (287a) Through-loading feature.	AR68.30-P-4800TA
<b>₩</b> AR		Without code (287a) Through-loading feature.	AR68.30-P-4800T
3	Remove side paneling in trunk	i Left paneling	
<b>₽</b> AR		With code (287a) Through-loading feature.	AR68.30-P-4800TA
<b>⇔</b> AR		Without code (287a) Through-loading feature.	AR68.30-P-4800T
4	Remove central audio component	i Part to be replaced by new central audio component.	
<b>₩</b> AR			AR82.60-P-7605T
5.1	Remove antenna	i Part no longer required	
<b>₩</b> AR			AR82.70-P-8951T
6	Remove left front and left rear cable duct covering		
7	Open left front and left rear cable duct		
8 ⊯FAR	Remove trim on left B-pillar		AR68.30-P-4700T
9 FAR	Remove front floor covering (left)	i Open the cable duct.	AR68.20-P-2050T
10	Remove radio	i Radio to be replaced by radio control panel and navigation unit (A2/56).	AR82.60-P-7502T
FAR □			ANO2.00-F-/3021
X	Install		
11	Retrofit antenna for global positioning system (GPS)	The new part is to be used.	AN82.61-P-7474-04TA
12	Retrofit antenna lead		AN82.62-P-0001-04T
13	Install remaining parts onto vehicle	i Steps 10 to 1.	

14	Perform subsequent variant coding for Audio 50 APS using Star-Diagnosis	i Central audio components in luggage compartment. In the instrument cluster. In Audio 50 APS.	
15	Enter special equipment in the vehicle data card and in the vehicle's online data card	i Code (525) MB Audio 50 APS radio.	

## Parts ordering notes

Part no.	Designation	Quantity
Design group 99 (see	Package contents: Audio 50 APS navigation system	1
EPC)		